

Fiero Stereo Systems



Northern Illinois Fiero Enthusiasts

19 May 2012

Original Stereo's



Repair

- Many places on internet will repair or you can buy replacements. Typically repairs run around \$65 to \$100. Replacements run \$150 to \$200.
- Cassette Belts Replacements can be bought thru Rodney Dickman or the Fiero Store.



Local Repair

AJR International
300 Regency Drive
Glendale Heights, IL 60139

Phone:

(800) 232 - 3965

Fax:

(800) 428 - 0333

Hours:

07:00 - 05:30 CDT

Newer GM Head Units



1



4



7



2



5



8



3



6



Adding 1989 or newer GM Radio

- Adapter or part of radio harness removed from donor car.
- Adapters run about \$20.
- Also need an antenna adapter due to size difference.
- Late 1990's and newer might also have "Theft-Loc" feature which requires a code to unlock.
- 2002 and newer uses data bus input. Adapter boxes to use these run \$150 to \$250.




Aftermarket Units and Adapters



Wiring Differences


Up To 1989-1990

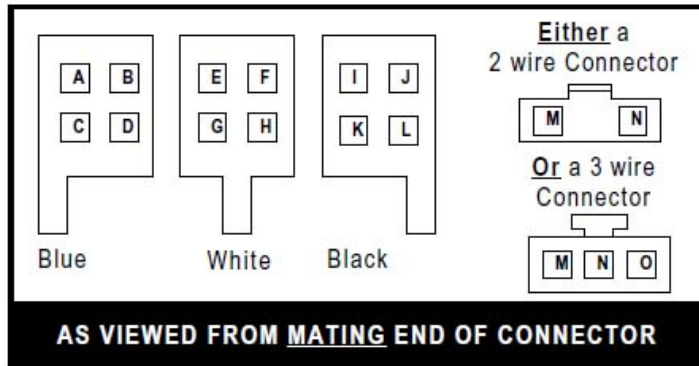

Pin	What It Is	Typical GM Factory In Dash Wire Color	Typical New Radio Equivalent Wire Color
A	Right Rear Spkr (-)	Light Blue	Purple w/ Black Stripe
B	Left Rear Spkr (-)	Yellow	Green w/ Black Stripe
C	Right Rear Spkr (+)	Dark Blue	Purple
D	Left Rear Spkr (+)	Brown	Green
E	Left Front Spkr (+)	Tan	White
F	Right Front Spkr (+)	Light Green	Gray
G	Left Front Spkr (-)	Light Gray	White w/ Black Stripe
H	Right Front Spkr (-)	Dark Green	Gray w/ Black Stripe
I	Power Antenna Turn On	Pink (if available)	Blue
J	+12 Volt Ignition Wire	Yellow	Red
K	Headlight Dimmer Wire	Gray	Orange (if available)
L	Ground Wire	Black	Black
M	+12 Volt Battery Wire	Orange	Yellow
N	Not Used		Not used


Wiring Differences

1989-1990 And Newer

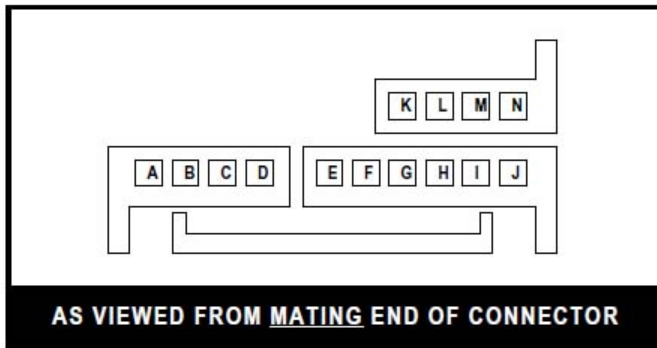

Pin	What It Is	Typical GM Factory In Dash Wire Color	Typical New Radio Equivalent Wire Color
A	Left Front Spkr (-)	Light Gray	White w/ Black Stripe
B	Left Front Spkr (+)	Tan	White
C	Right Front Spkr (-)	Light Green	Gray w/ Black Stripe
D	Right Front Spkr (+)	Dark Green	Gray
E	Ground Wire	Black	Black
F	Not Used		
G	Headlight Dimmer Wire	Gray	Orange (if available)
H	Power Antenna Turn On	Pink (if available)	Blue
I	+12 Volt Ignition Wire	Yellow	Red
J	+12 Volt Battery Wire	Orange	Yellow
K	Right Rear Spkr (-)	Light Blue	Purple w/ Black Stripe
L	Right Rear Spkr (+)	Dark Blue	Purple
M	Left Rear Spkr (-)	Yellow	Green w/ Black Stripe
N	Left Rear Spkr (+)	Brown	Green

Standard sized antenna cable and connector

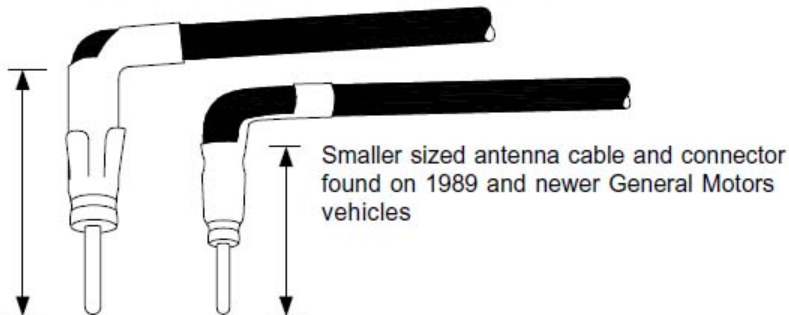

“Theft-Loc”

- The radio must be in LOC mode NOT in INOP mode.
- Turn the ignition ON (The radio displays LOC).
- Press and hold presets buttons 2 & 3 or 1 & 4 for approximately 10 seconds.
- The radio display changes from LOC to a three-digit number.
- Write this number down.
- You will then have fifteen seconds max before the next step must be performed.
- Press the AM/FM button.
- The radio display changes to another three-digit number.
- Write this number to the right of the first one.
- You now have a six or four-digit number, the first three digits are from STEP 3 and the last three digits are from STEP 5.
- If you have a four digit number, it will show all four digits at the same time.
- Call this number, it's a prerecorded message, so don't worry about having to talk to anyone...**1-800-537-5140**. The voice will ask if you're calling for Chevy, Pontiac, Cadillac, etc... When you here him tell you to press "2" for Pontiac, press 206010 and hit the # key. He'll ask you for the 6 digit code that you've written down. Enter that and press the * key. He will then give you a code, and the option to get additional 4 digit codes, but one should be sufficient.

Factory Speaker Upgrades



- Dash 4X10
- 84/85 Seats 3.5”
(2 pairs required)
- 86-88 Sail Panels 4X6
- Optional 4X6 Plates
(may require metal trimming)

Subwoofers

Factory Performance Sound

Rodney Dickman's Factory Sub
Replacement Speaker.

1986 thru 1988 "Performance
Sound" Option.




Front Speaker Grills

Grill cloth can be replaced as it fades over time.

Many places like Rodney Dickman or local automotive Upholstery places sells grill cloth.

Just need to make sure it is automotive grade and has UV Protection.

Original Faded / New Replacement

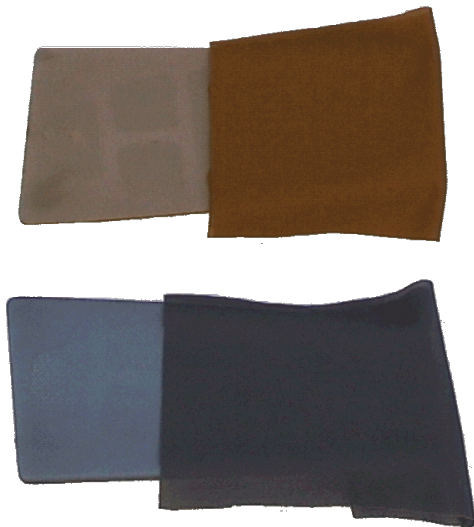

Rear/Seat Speakers and Covers



- Seat covers need to be removed to access headrest speakers.



- Rear Sail Panel speakers on 1986 – 1988 Fiero's have grill "melted" into panel.

Questions / Answers



 PONTIAC



Driving Excitement

